

**THE VALE OF
GLAMORGAN COUNCIL**

TOWN AND COUNTRY PLANNING ACT 1990

APPROVED

SUBJECT TO COMPLIANCE WITH CONDITIONS (IF ANY)

**STRUCTURAL SURVEY
AT
18 CLIVE PLACE, PENARTH**

-000-

planning application

PP - 03545370

for L. JAMES

17 CAYNHAM AVE

PENARTH

CF6 4 5RE.

1400876FUL

RECEIVED

23 JUL 2014

ENVIRONMENTAL
AND ECONOMIC
REGENERATION

PETER CHAPMAN ASSOCIATES
Consulting Engineers
2 Royal Buildings
Stanwell Road
Penarth
Vale of Glamorgan

October 2013

3889

TO WHOMSOEVER IT MAY CONCERN

Structural Survey at 18 Clive Place, Penarth

Introduction

We are instructed to inspect this property and to report on the extent and significance of any structural defects found, with recommendations for remedial works.

We have been provided with copy of a condition survey carried out by Martin Cotsen, Chartered Surveyor, and concur with his observations.

An initial inspection of the property was made by Peter Chapman, Principal of this firm, on 11th September 2013, with a repeat visit for record photography on 3rd October.

All references to left and right in this report are to be taken as viewing from front to rear.

Exterior walls

A. Front elevation

On the front elevation there is a bay window with Portland Stone framing to the windows and stone mullions. All are in reasonably good condition, with no indications of significant movement. However, all walls on this elevation have been extensively re-pointed, in particular the walls above first floor level, indicating a history of movement which had caused cracking which had disrupted the original stonework pointing..

The replaced pointing is most intensive around a blocked up window above the first floor bedroom windows, (ref. Photograph 1) which presumably gave light into the roof space .

Immediately below this area there two bedroom windows separated by a brickwork pier forming a shared mullion (ref. Photograph 1). It can be clearly seen that the two brick arches above these windows have suffered a degree of failure, the arch springings on the central brickwork pier being noticeably lower than those on the outer brickwork reveals. Much re-pointing has been carried out on the arches themselves, and it is clear that at some time in the past there was extensive disruption of the arch brickwork, with several bricks in each of the arches having been replaced to restore their integrity and their ability .to support the stonework panel above

The loading from this stonework will be considerable, with the major proportion being carried on the brickwork pier between the windows which has moved downwards by an estimated 20-25mm. This has resulted in the movement in the brick arch springings referred to above, and the arch failures. are a direct consequence. If Photograph 2 is referred to it will be seen that the two external window sills slope noticeably downwards towards the pier, confirming its downward movement.

The loading from the pier will be carried on a bressummer, most probably a double timber beams, spanning across the bay window opening in the front wall, and the downward movement of the pier is an indication that it has become overloaded, either because it was sized inadequately when the house was built, or because there has been a deterioration in the timber.

This could happen if the end bearings of the beams developed wet rot as a result of becoming exposed to moisture for a significant length of time due to rain penetrating into the wall through cracks in the mortar joints. Alternatively the timber could have been weakened by insect infestation or possibly dry rot. At all events, whatever the cause it is highly likely that it will continue to develop, increasingly weakening the bressummer, with continuing downward movement. In a 'worst case scenario' the bressummer could fail completely at some future time, leading to a partial collapse of the front wall

B. Side & Rear Elevations

The side wall adjacent to the front elevation

The side wall of the rear annexe shows signs of subsidence at and near the rear corner. Vertical movement of the wall is indicated by a very noticeable failure of a brick arch over a window approximately 1.2m from the corner (ref Photograph 3), where a block of three bricks has become displaced downwards, requiring re-pointing at some time in the past. There is a raking crack sunning upwards towards the right from the arch and meeting another crack near the corner where the brick quoin has separated from the main stonework. (ref. Photograph 4.

The remainder of this wall is in a reasonable sound condition, (ref Photographs 5 & 6) but the rear wall, which is rendered, has minor cracks which run with a mainly vertical orientation upwards to the gable roof verge near the outer corner. (ref Photographs 7 & 8) The disposition and orientation ,of this cracking is indicative of a minor subsidence at the rear corner of the building

C. Garage Walls

The garage is in an overall poor condition, bordering on dilapidation. There is a pronounced vertical crack, varying between 4mm - 8mm, in the front wall, running for the full height from ground level to roof' ref Photographs 9 & 10 (crack behind shelving). The cause of this is not clear, but it is likely to be either a degree of subsidence at one of the front corners or a result of the wall contracting with seasonal thermal changes. The vertical orientation suggests that the latter is the most likely. The remaining walls are in sound condition.

D. Boundary walls

The wall on the left hand side is in a generally poor condition, with an approximately 3 metre length abutting the rear boundary wall in a state of complete collapse. For most of its length the rest of this wall is leaning outwards towards No. 16 at a considerable angle from the vertical, such that it cannot be far from collapsing into that property. This condition is likely to worsen with time, and could become dangerous

On the opposite side of the property the wall is not in such poor condition, though there is some deterioration in the pointing.

The rear boundary wall is in a similarly reasonably sound condition, with some attention being required to the pointing to ensure that it does not begin to deteriorate in the future.

Internal walls

14 00876 FUL

E. Internal Walls

By far the majority of the internal walls are in good condition with little sign of cracking or disruption. The exception is the inside face of the wall on the front elevation which shows minor cracking which mirrors that seen externally.

Several of the walls on the first floor show damp areas along the wall/ceiling junctions where there are roof edges and guttering externally. These appear to be currently dry, only shown by dark areas in these zones. In one or two locations covings have become detached from the substrates, due to dampness affecting the fixing adhesives.

F. ROOF

Access to the roof void was only possible via a very small hatch which did not permit more than a 'head and shoulders' inspection, with very limited lighting restricting the extent to which the roof structure could be seen. The roof members which could be seen appeared to be in reasonable condition, with no water staining which might indicate a history of roof leakage in the past.

G. Recommendations

A priority item will be to investigate the cause of the bressummer deflecting. To achieve this it will be necessary to expose the bressummer from within the front room inside the bay window. As a first stage the timber bearings at each end on the front wall should be exposed so that their condition can be ascertained. If they are found to be sound, more exposure along the length of the beams will be required to check for infestation by boring insects or dry rot. If serious defects are found in the timber beams there is a likelihood that the movement, the results of which are seen externally, will redevelop, with the extensive repaired cracks re-opening, and the timber beams should be replaced by steel.

Before considering measures, if any, to eliminate the subsidence at the right hand rear corner of the building, it will be necessary to establish why this has developed. One possible cause could be a weakening of the subsoil beneath the foundations due to leakage from a fractured drain or water supply pipe in that locality, so it will be necessary to excavate around that corner to investigate the foundations and their bearings and the drain runs and their proximity to the walls. Before commencing this work it would be wise to monitor the crack by installing tell-tales, to be read every two months for at least six months, to confirm or otherwise that the subsidence movement is continuing.

This exercise will determine whether underpinning of the foundations is required or merely repairing any defects found in underground pipes

When all the work found to be required in these walls has been carried out the cracks in the masonry should be repaired by breaking out cracked or broken stone, and raking out cracked mortar joints to a minimum depth of 75mm, to be refilled with a well-rammed semi-dry 1:1:6 mix cement:lime:sand mortar, to be neatly pointed. on completion.

The entire system of roof guttering should be inspected for blockage, either partial or complete, which could cause overflowing onto or the walls alongside them, causing the high level dampness noted above.

The crack in the garage wall should be repaired by carefully breaking out cracked or broken blocks which straddle the crack, and replacing them with new blocks as necessary, set in neatly pointed mortar as above, followed by replacing the external cement mortar rendering, and decoration.

The left hand boundary wall has deteriorated past the point of no return, and should be taken down completely and rebuilt to a good standard. Consideration could be given to arresting the deterioration of the right hand wall by also taking it down and rebuilding it.

Internal cracks in excess of 1mm width should be repaired by filling with a semi-flexible decorators' caulk, followed by redecoration as appropriate.

H. Limitations of this Report

We have not examined any parts of the building which are covered, unexposed or inaccessible, and we are therefore unable to report that any such part of the building is free from defect.

October 2013

3889

14 00 87 6 FUL

**STRUCTURAL SURVEY
AT
18 CLIVE PLACE, PENARTH**

-o0o-

**RECORD PHOTOGRAPHS TAKEN
ON
1TH SEPTEMBER 2013**



PHOTOGRAPH 1



PHOTOGRAPH 2

1400876FUL



PHOTOGRAPH 3



PHOTOGRAPH 4



PHOTOGRAPH 5



PHOTOGRAPH 6

1400876FUL



PHOTOGRAPH 7



PHOTOGRAPH 8



PHOTOGRAPH 9



PHOTOGRAPH 10

1400876FUL



PHOTOGRAPH 11



PHOTOGRAPH 12